

DATE 0326Z 15 FEB 63

SECRET

TO DIRECTOR

25X1A
FROM

ACTION: OSA (1-2-3-4-5-6-7-8-9-10)

INFO S/C (11)

TOR: 0416Z 15 FEB 63

OPERATIONAL IMMEDIATE

IN 66156

25X1A

DOCUMENT NO.

NO CHANGE IN CLASS. ☒ X

☐ DECLASSIFIED

CLASS. CHANGED TO: TS S G

NEXT REVIEW DATE: 2011

AUTH: HR 70-2

DATE: 30/7/11 REVIEWER: 064540

8438

25X1A

1. SYSTEM XII MODIFICATION NOW FUNCTIONING PROPERLY ON BENCH AND WILL BE INSTALLED IN ARTICLE ASAP.
2. FINAL REPAIR EFFORT COMPRISED REPLACEMENT OF Q1001, AND RESOLDERING R1009 AND C1010 CONNECTIONS. THIS RESOLDERING WAS NECESSITATED BY OUR DETECTING A SPORADIC RECTIFYING CONDITION, EXISTING IN MANUFACTURER'S ORIGINAL WIRING, IN THE ELECTRICAL CONNECTION BETWEEN C1010 AND R1009 (POSSIBLY DUE TO FAILURE TO CLEAN LEADS BEFORE SOLDERING, OR OXIDE CONDITION THEREON). THIS RECTIFYING CONDITION PREVENTED THE PLUS 15 VOLTS FROM FEEDING TO AND THRU R1009.
3. IN VIEW THIS SUCCESSFUL REPAIR, RECOMMEND ACTION DESCRIBED PARA 2 AND PARA 3 REF BE REVISED AS FOLLOWS:
 - A. CONCUR PARA 2, BUT SUGGEST ANY CLASSIFIED ITEMS BE EITHER TOUCHED OR INCLUDED NEXT NORMAL COURIER MOVEMENT. DO NOT BELIEVE SPECIAL COURIER JUSTIFIED. WE HAVE A CRITICAL REQUIREMENT FOR

SECRET

25X1

Approved For Release 2002/09/04 : CIA-RDP66B00728R000200230036-4

Approved For Release 2002/09/04 : CIA-RDP66B00728R000200230036-4